Measuring compressed air quality according to ISO 8573


Compressed air is an expensive, but also indispensable medium in industrial, automated production. It is therefore all the more important for users to always keep an eye on the quality of their compressed air system.

ISO 8573 is an internationally recognised standard that defines the most important impurities in compressed air. The implementation of this standard supports the precise testing of the most important impurities in compressed air particles, water, gas, microbiological and oil contamination.

However, some of these methods require samples to be analyzed in a laboratory. This is always associated with time delays and only provides the customer with an average snapshot over the measured period and is not always practical.

So how do we measure these impurities under everyday, real operating conditions?

CS Instruments offers this customized solutions for stationary and mobile monitoring. An alarm can be used to signal that maintenance work is required on the compressed air treatment system (dryer and filter) so that oil, water and particles do not enter the compressed air network. This reduced prevents the risk of contamination of end products and increases the process reliability and life span of pneumatic components.

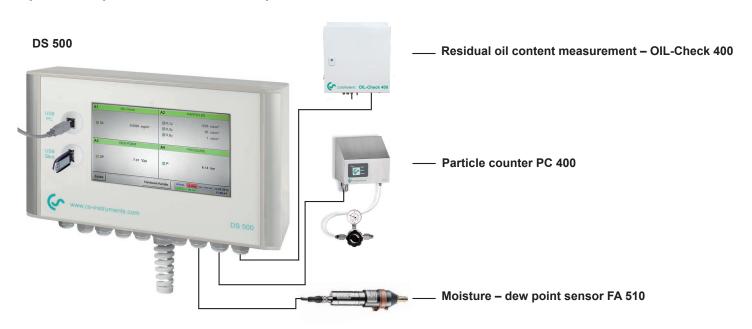

Compressed air quality



ISO 8573 consists of the following parts, under the general title Compressed air:

Anwendungen von Druckluft:

- · Part 1: Contaminants and purity classes
- Part 2: Test methods for oil aerosol content
- Part 3: Test methods for measurement of humidity
- Part 4: Test methods for solid particle content
- Part 5: Test methods for oil vapour and organic solvent content
- · Part 6: Test methods for gaseous contaminant content
- · Part 7: Test method for viable microbiological contaminant content
- Part 8: Test methods for solid particle content by mass concentration
- · Part 9: Test methods for liquid water content

	Solid particles			Water	ÖI			
ISO 8573-1:2010 Class	Maximum number of particles per m³			Vapour pressure dew	Total share of oil (liquid aerosol and fog)			
Glass	0.1 - 0.5 μm	0.5 - 1 μm	1 - 5 μm	point	mg/ m³			
0	In accordance with specification by the device user, stricter requirements than class 1							
1	<= 20,000	<= 400	<= 10	<= -70 °C	0.01			
2	<= 400,000	<= 6,000	<= 100	<= -40 °C	0.1			
3		<= 90,000	<= 1,000	<= -20 °C	1			
4			<= 10,000	<= +3 °C	5			
5			<= 100,000	<= +7 °C				
6				<= +10 °C				
7								
8								
9								
х								

In this editorial we will focus on the inline methods to detect oil aerosols, humidity and particles (including microbiological contaminants) on a continuous basis.

Oil aerosol content:

Looking at ISO 8573-2, there are different test methods authorized to measure oil aerosol content.

The following table is taken from the ISO 8573-2 standard document. The measurement methods correspond to a temporal sample. The results can therefore be used for validation.

Parameter Method A - Full flow		Method B - Full flow	Method B2 - Partial flow		
Contamination range	1 mg/m³ to 40 mg/m³	0,001 mg/m³ to 10 mg/m³	0,001 mg/m³ to 10 mg/m³		
Max. velocity in filter	See 7.1.2.10	1 m/s	1 m/s		
Sensitivity	0,25 mg/m³	0,001 mg/m³	0,001 mg/m³		
Accuracy	± 10% of actual value	± 10% of actual value	± 10% of actual value		
Max. temperature	100 C°	40 C°	40 C°		
Testing time (typical)	50 h to 200 h	2 min to 10 h	2 min to 10 h		
Filter construction	Filter construction Coalescing line filter		Treee-layer membrane		

For online measurements, which will give the user a continuous readout, also an indication of peak contamination conditions, modern methods like PID sensor technologies are being used. These sensors offer a permanent, highly precise oil vapour measurement by making use of the photo-ionic-detector method (PID).

The sensors can easily get connected to the compressed air system through a ball valve or quick coupler and analyse the air on a continuous base. Long term stability can be insured by making use of a catalytic converter in order to burn off all hydrocarbons present in the air, hence making the air ideal to use for period zero calibrations while running.

The readouts are continuous and can be recorded as well as trigger alarms if limit values are breached. This corresponds to the main advantages compared to the temporary measurement method.

Residual oil content measurement - OIL-Check 400

The Oil-Check 400 enables permanent and highly precise measurement of the vaporous residual oil content from 0.001 mg/m³ to 2.5 mg/m³. Due to the minimum measured value of 0.001 mg/m³, the compressed air quality class 1 (ISO 8573) can be monitored. This means that the entire measuring range can be monitored with the Oil Check.

Measurement of humidity:

ISO 8573-3 looks at test methods for the measurement of humidity. This next table has been taken out of the ISO 8573-3 standard document:

Method in order of uncertainty		Uncertainty ±°C	Range for humidity level expressed as pressure dew point°, °C						Remarks		
Method	Table		-80	-60	-40	-20	0	+20	+40	+60	
Spectroscopic	2	а	-				—				Detection limit for water va- pour is about 0,1 x 10-6 to 1 x 10-6 b
Condensation	3 and 4	0,2 to 1,0	—						$\overline{}$		
Chemical	5	1,0 to 2,0							-		
Electrical	6, 7 and 8	2,0 to 5,,0	<u> </u>						-		
Psychrometer	9	2,0 to 5,0				\vdash				\dashv	

a The uncertainty is not yet available in °C.

The spectroscopic and condensation methods are very accurate but also very expensive to use as continuous measuring solutions. The chemical and psychrometers are spot checks which can't be used for continuous measurements. The most commonly used method to measure humidity levels and dew point temperatures are the electrical method. The most commonly used sensors in this category are sensors based on capacitance.

This is due to the fact that these sensors offer the greatest measuring range with very good accuracies and repeatabilities.

These sensors can also easily be installed through a ball valve or a quick coupler and give continuous measurements which can be recorded and/ or used to trigger alarms if limit values are breached.

Moisture - dew point sensor FA 510

FA 510 measures the pressure dew point down to -80 °Ctd. Also in this case the continuous measurement takes care that alert is triggered immediately if the compressed air dryer breaks down. The sensor enables permanent monitoring of the compressed air dryer.

Particle content:

ISO 8573-4 looks at test methods for solid particle content.

This next table has been taken out of the ISO 8573-4 standard document:

Method	Applicable concentration range	Applicable solid particle diameter				
	particles/m³	d μm				
		< 0,10 0,5 1 <5				
Laser particle counter	0 to 10 ⁵	<u> </u>				
Condensation nucleus counter	10 ² to 10 ⁸	├				
Differential mobility analyser	Not applicable					
Scanning mobility particle sizer	10² to 10 ⁸					
Sampling on membrane surface in conjunction with a microscope	0 to 10 ³	<u> </u>				

The most commonly used test method for measurement of solid particle content by counting is by using laser particle counters. The sensors can easily get connected to the compressed air system through a ball valve or quick coupler and analyse the air on a continuous base. Accuracy is influenced by the size of the laser diode and optics in use as well as the flow rate through the instrument. The greater the air volume that can be analysed at a particular time the higher the achieved accuracy.

b Volume fraction.

c Pressure dew point is defined in ISO 7183.

Compressed air quality



Some laser particle counters only measure down to a particle size of 0.3µm (microns). This is not adequate for the food industry as particle sizes down to 0.1µm need to be detected in order to be able to determine the ISO 8573 classes.

Particle counter PC 400


The highly precise, optical particle counter PC 400 measures particles from a size of 0.1 µm and is therefore suitable for monitoring the compressed air quality class 1 (ISO 8573).

DS 500 - the intelligent chart recorder of the next generation

The centerpiece of comressed air quality measurement is the chart recorder DS 500. It measures and documents the measured data of the sensors for residual oil content, particles and moisture. The measured values are indicated on a 7" colour screen. The curve progressions from the beginning of the measurement can be viewed by an easy slide of the finger.

The integrated data logger stores the measured values safely and reliably. The threshold value can be freely entered for each measured parameter. 4 alarm relays are available for automatic alarm in case of threshold value exceedance.

Optionally DS 500 can be upgraded with up to 12 sensor inputs. For connection to a PLC DS 500 has an Ethernet interface as well as a RS 485 interface. The communication is done via the Modbus protocol.

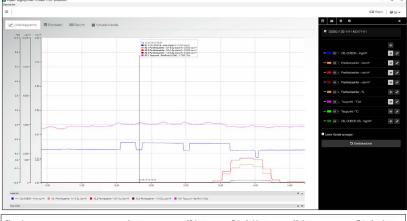

Graphical and tabular evaluation of the measured data via PC software

